

**MIL ILLUMINATED WITH DTC P0756, P0761 OR P0771
AFTER OVERHAUL OR INSTALLATION OF 2005
TORQSHIFT TRANSMISSION**

TSB 04-25-16

FORD:

2003-2004 Excursion, F-Super Duty
2004 E-Series

ISSUE

Some vehicles equipped with a 6.0L diesel and the Torqshift transmission, may exhibit the malfunction indicator lamp (MIL) illuminated with diagnostic trouble code (DTC) P0756, P0761 or P0771. This condition will occur if the powertrain control module (PCM) and transmission control module (TCM) are not reprogrammed after installing a 2005-level replacement transmission, installing transmission rebuild kit 5C3Z-7A398-SA, or after overhauling the transmission with 2005-level components.

ACTION

Reprogram the PCM and TCM to the latest calibration using WDS release B34.2 or higher. Calibration files may also be obtained at www.motorcraft.com. Clear KAM, DTCs and verify repair.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage

OPERATION	DESCRIPTION	TIME
042516A	Check For Diagnostic Trouble Codes And Reprogram The Powertrain Control Module (PCM) And The Transmission Control Module (TCM)	0.7 Hr.

DEALER CODING

BASIC PART NO.
RECALEM

CONDITION
CODE
42

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.