

FORD:

1997-2005 E-Series, F-150, F-Super Duty

ISSUE

Some 1997-2005 E-Series/F-150/F-Super Duty 4x2 vehicles may exhibit a driveline clunk or bump that occurs as the vehicle starts to move forward, following a stop. This condition may be caused by the slip yoke not sliding smoothly on the output shaft splines.

ACTION

Lubricate the slip yoke with Motorcraft PTFE Lubricant. Refer to the following Service Procedure.

SERVICE PROCEDURE

1. Verify the condition.
2. Remove the driveshaft per Workshop Manual Section 205-01. Be sure to index-mark the driveshaft during removal to maintain alignment during reinstallation.
3. Lubricate the slip yoke with 7-13 grams (0.25-0.46 oz.) of Motorcraft PTFE Lubricant.
4. Re-index and reinstall the driveshaft per Workshop Manual.
5. Verify the repair.

PART NUMBER	PART NAME
D2AZ-19590-A (1 lb) or XG-8 (3 oz.)	Motorcraft PTFE Lubricant

OTHER APPLICABLE ARTICLES: 04-1-6

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION	DESCRIPTION	TIME
042606A	F-150: Lubricate Driveshaft Slip-Yoke (Includes Time For Road Test To Verify Concern, Driveshaft R and I, And Road Test To Verify Repair)	1.0 Hrs.
042606A	E-Series and F-Super Duty: Lubricate Driveshaft Slip-Yoke (Includes Time For Road Test To Verify Concern, Driveshaft R and I, And Road Test To Verify Repair)	1.2 Hrs.

DEALER CODING

BASIC PART NO.
4602

CONDITION
CODE
42

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.