

TRANSMISSION—ALL—VEHICLE CAN BE SHIFTED OUT OF “PARK” WITHOUT DEPRESSING BRAKE PEDAL—ECONOLINE CUTAWAYS ONLY AND F-SERIES BUILT THROUGH 2/28/95

**Article No.
96-8-18**

FORD: 1994-1995 BRONCO, ECONOLINE, F SUPER DUTY, F-150-350 SERIES

ISSUE

The customer may be able to shift the vehicle out of “Park” without depressing the brake pedal on some vehicles. This may occur if no high mount stoplamp is installed or the bulb filament is either missing or open, simulating the brake pedal being depressed.

ACTION

Install a jumper harness with a resistor to simulate the presence of a high mount stoplamp or replace the high mount stoplamp if the bulb is open. Refer to the following Service Procedure for details.

SERVICE PROCEDURE - ECONOLINE

1. If a high mount stoplamp is installed, check to make sure the bulb filament is not missing or open. Repair as required.
2. Locate the -14A200- wire harness along the B-pillar behind the driver's seat.
3. Locate brake test connector C358, Figure 1. This is a 2-way gray connector.
4. Install the jumper into the connector.
5. Wrap the main body wire harness with polyken tape. This will hold the connector in place and prevent any rattles of the connector to the B-pillar.

SERVICE PROCEDURE - F-SERIES

1. Check to make sure the high mount stoplamp bulb filament is not missing or open. Repair as required.

2. Locate the -14334- wire harness in the rear of the cab near the center high mount stoplamp.
3. Plug the jumper harness into the connector that would plug into the center high mount stoplamp. Wrap the jumper and connector with polyken tape and tape to inner sheet metal. This will hold the connector in place and prevent any rattles of the connector.

PART NUMBER	PART NAME
F6TZ-13A409-AA	Jumper Harness (F-Series)
F5UZ-13A427-AB	Jumper Harness (Econoline)
E6DZ-13466-B	High Mount Stoplamp Bulb
(Obtain Locally)	Polyken Tape

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

OPERATION	DESCRIPTION	TIME
960818A	Add Jumper Harness Or Replace Cab High Mount Stoplamp Bulb	0.3 Hr.

DEALER CODING

BASIC PART NO.	CONDITION CODE
14A200	79

OASIS CODES: 203000, 203200, 301000, 503300

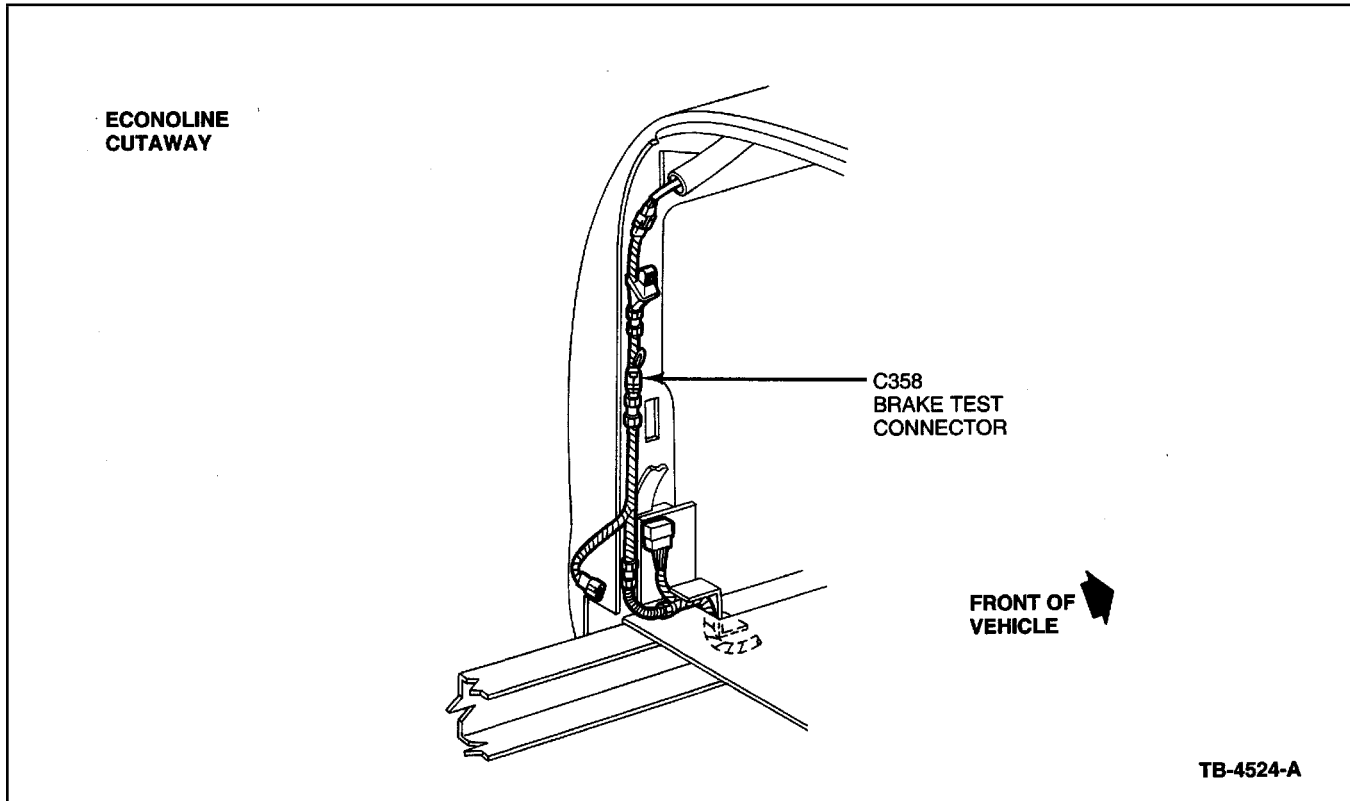


Figure 1 - Article 96-8-18