

<ul style="list-style-type: none"> <li>• <b>BRAKES—“WHISTLING” NOISE FROM HYDRO-MAX BRAKE BOOSTER ASSEMBLY—MOTORHOME CHASSIS VEHICLES</b></li> <li>• <b>NOISE—“WHISTLING” FROM HYDRO-MAX BRAKE BOOSTER ASSEMBLY—MOTORHOME CHASSIS VEHICLES</b></li> </ul>	<b>Article No. 98-22-4</b>
---	--------------------------------

**FORD:** 1999 SUPER DUTY F SERIES

**ISSUE**

A “whistling” noise under light to moderate brake applications may occur on some vehicles. This may be caused by the contour of the valve in the Hydro-Max brake booster which permits fluid to pass around it resulting in a whistling noise.

**ACTION**

Replace the Hydro-Max assembly with a revised Hydro-Max assembly. Refer the 1999 F Super Duty Workshop Manual, Volume 1, Section 206-07, Power Brake Actuation, for service procedure details.

**OTHER APPLICABLE ARTICLES:** NONE

**WARRANTY STATUS:** Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage

<b>OPERATION</b>	<b>DESCRIPTION</b>	<b>TIME</b>
982204A	Replace Brake Booster	0.9 Hr.

**DEALER CODING**

<b>BASIC PART NO.</b>	<b>CONDITION CODE</b>
2005	33

**OASIS CODES:** 301000, 702000, 702100

<b>PART NUMBER</b>	<b>PART NAME</b>
F81Z-2005-CA	Hydro-Max Assembly